SKYTRON

ELITE SERIES SURGICAL TABLES

UNCRATING INSTRUCTIONS

MODEL 1700 SERIES

1700 SERIES SURGICAL TABLE UNCRATING INSTRUCTIONS

NOTE

Always contact your SKYTRON representative prior to uncrating and use to ensure proper performance and safety.

RECOMMENDED TOOLS FOR UNCRATING: Claw hammer, nail puller, crow-bar, razor knife, and adjustable wrench. An electrical power outlet must also be available.

UNCRATING PROCEDURE

1. Cut and remove the plastic straps and remove the nails around the base of the crate. See figure 1. Remove the complete box top and sides as an assembly by lifting it straight up over the table.

NOTE

At this time, inspect the table thoroughly for shipping damage. Notify the trucking company immediately if damage has occurred.

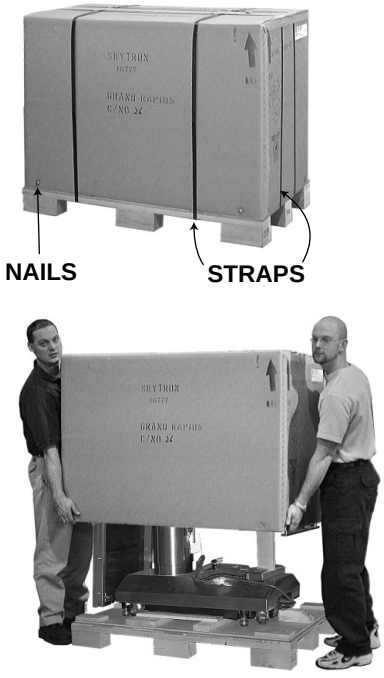

Figure 1.

2. Connect the hand control unit to the table connector, plug the power cord into electrical outlet, and raise the table top approximately 10" to 12" and extend the foot/leg section. Remove the nails securing the positioning blocks and remove the outer blocks. See figure 2.

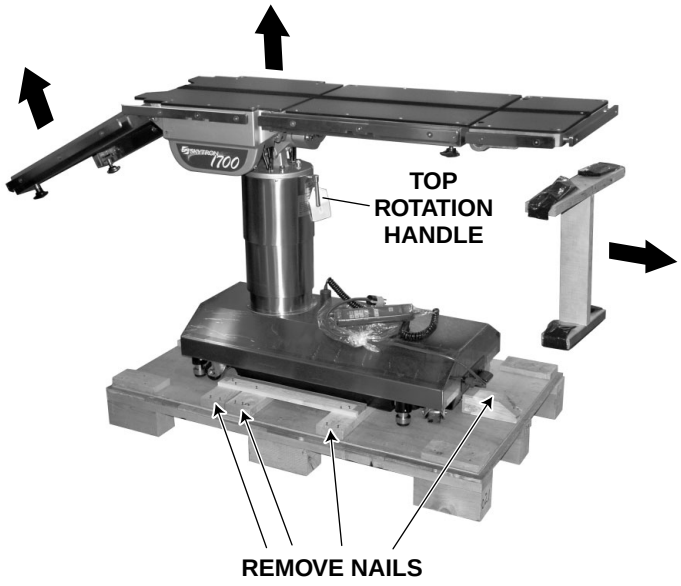

Figure 2.

3. The positioning blocks that extend under the table are two-piece. To remove them, unlock the table Top Rotation Lock Handle, rotate the table top 90° and tighten the Top Rotation Handle (figure 2). Rock the table to one side and remove the blocks, then rock the table to the other side and remove the remaining blocks. See figure 3.

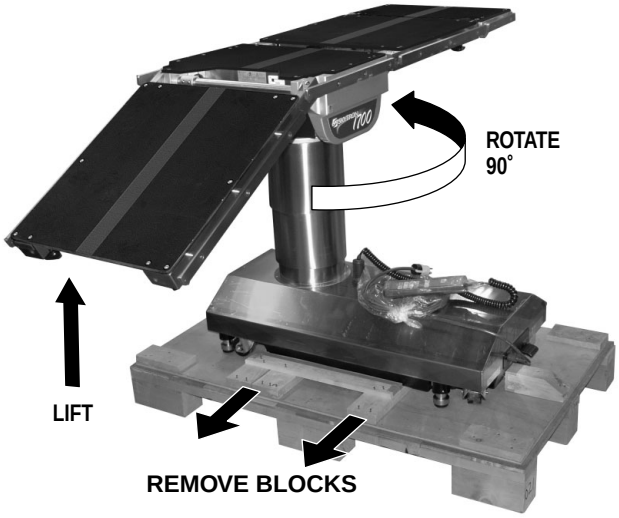

Figure 3.

4. Rotate the table top back to original position and tighten the Top Rotation Lock Handle. **RELEASE THE TABLE BRAKES WITH THE HAND CONTROL.**

5. Slide the head end of the table off from the crate base (figure 4) and position it so that just the edge of the table remains on the crate base.

6. Lift upward on the foot end of the table and slide the crate base out from under the table and lower the table gently.

7. Check the crate thoroughly for table parts and accessories before discarding. Pad set may be attached to the crate top.

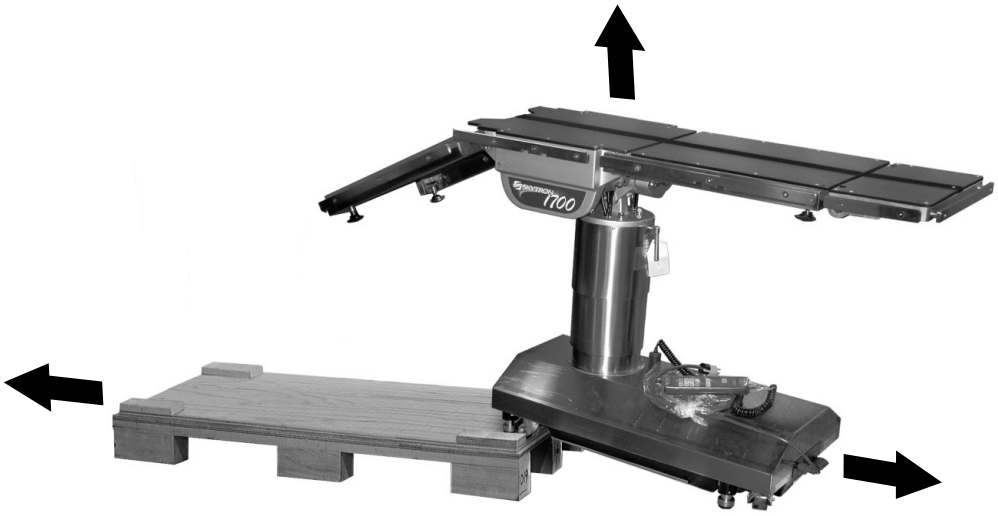

Figure 4.

IMPORTANT

Cycle all functions to be sure the table operates correctly before delivering to the surgery area.

SKYTRON
5000 36th Street S.E., Grand Rapids, MI 49512
1-800-SKYTRON or 1-616-957-0500 • FAX 1-616-957-5053